

**Date:** 11/17/17

**TSB Number:** TSB-0003

**Route to:** Modernization/Service Manager

**Reference:** CXN board

**Subject:** CXN found unacceptable by TSSA

**Action:** Required

**Equipment:** SRH, Hydraulic Controller, SRA Traction Controller, SRD DC Controller

**Description:** The inputs from the locks on the primary side of opto-isolator were being toggled for all locks at the start of the run, only for the locks at the current floor.

**Fix:** We have remade the CXN board to drop and pick all lock circuits before every run.

**Do the following:**

1. Replace the existing board with the new one. This must be done on all installed jobs by 12/8/17.
2. A follow up inspection must be scheduled with TSSA.

**Affected job(s) on file:**